TSB #	SUBJECT	DATE
GI202510-07	Toyota ECU Reset	10/28/2025

Overview:

In some situations, a Toyota/Lexus ECU may become unresponsive to OBD commands. This may happen if the Tire Set button is pressed before the TPMS IDs are properly registered. An ECU reset may be needed to regain OBD Communications.

Process:

1. Inflate Tires to Placard
2. Using **VINdicate®** or **MMY Look up**, select vehicle
3. Navigate to **Relearn** > **Relearn: OBD RITE-SYNC®**
4. Once vehicle audit screen is displayed, press the **power/menu** button on your tool
5. Select "**Toyota ECU Reset**"
6. Following on tool prompts, connect cable or wireless VCI to the vehicles OBDII Port
7. Cycle key/push button to ignition ON Engine OFF
8. Press ENTER on tool to begin ECU Reset
9. Proceed with relearn if necessary

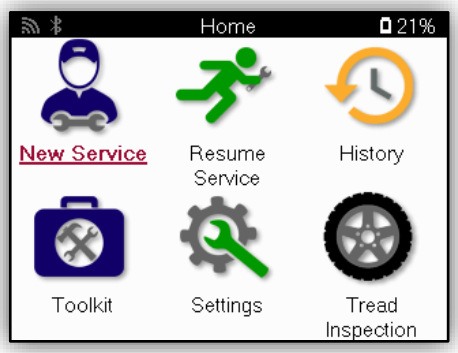

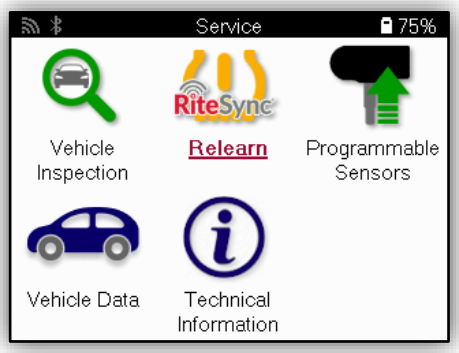

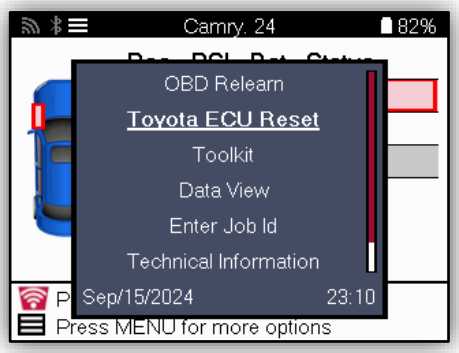

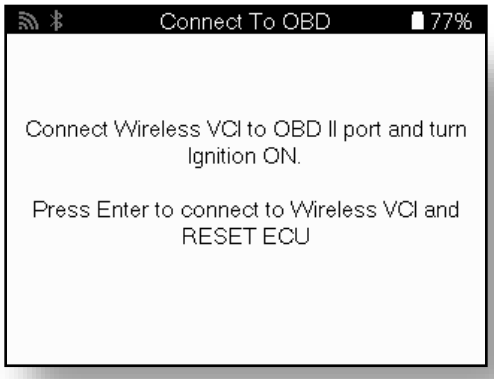

©2025, Bartec USA, LLC
Bartec USA Technical Support: [866]407-8767
Bartec makes commercially reasonable efforts to provide accurate and complete data in connection with our tools and our website, but the volume of data compiled and the variety of sources from which the data comes makes it impossible to warrant full accuracy or completeness of any kind. AS A RESULT, BARTEC DOES NOT WARRANT, AND SPECIFICALLY DISCLAIMS ANY WARRANTY, THAT OUR TOOLS, WEBSITE, AND/OR THE CONTENT CONTAINED THEREIN IS ACCURATE OR COMPLETE.